

Refinery Reduced Risk of Shutdowns and Improved Plant Safety with Advanced Diagnostics Capability

RESULTS

- Decreased risk of unplanned heater shutdowns
- Reduced safety risks



APPLICATION

Fired heater flame instability detection

CUSTOMER

Large refinery located in North America

CHALLENGE


This refinery recently installed ultra low NOx burners to their existing fired heaters for compliance with new Environmental Protection Agency emission regulations. As part of the inherent ultra low NOx emission design, the burners run very lean and are constantly on the verge of flame-out. Therefore, a flame-out detection system is required to ensure that fuel gas does not continue to be charged to the burner chamber and create an explosive environment. Preferably, the refinery wanted an early warning system to detect flame instability before a complete shutdown of the unit.

The refinery previously tried two different solutions to solve this problem. The first solution was an optical detector (FIREYE) to detect the presence of a flame. This solution worked reasonably well, but was cost prohibitive because each low NOx burner required a dedicated optical detector to ensure the presence of a flame. This amounted to several hundred detectors for a large furnace, and was too costly to implement.

The second system the refinery tried was a very sensitive and very fast DP transmitter made by another manufacturer. Although the shop tests were positive, actual field tests revealed high drift and a lack of reliability.

Absence of an early warning system to detect flame instability did not provide the operators with any opportunity to take corrective action (i.e. add more fuel gas to enrich the burner feed) to prevent fired heater

The advanced diagnostics capability of the Rosemount™ 3051S provided this refinery with a viable means of reducing the risk of low NOx burner flame-out and preventing unplanned heater shutdowns.

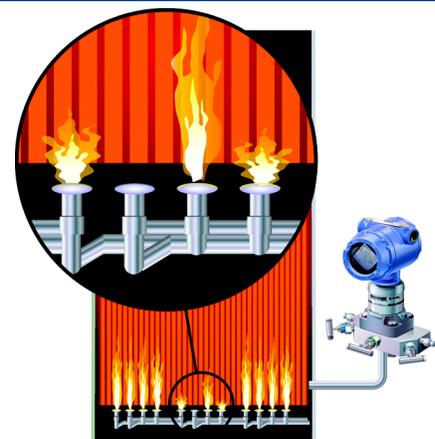

Detecting furnace flame instability with Rosemount 3051S

shutdown in case of a flame-out situation. This increased the risk of unplanned unit shutdowns, reduced plant availability, and reduced throughput. In addition, it also increased safety risk due to the possibility of creating an explosive environment in the fired heater during a flame-out condition.

SOLUTION

The customer solved this problem by installing a Rosemount 3051S Pressure Transmitter with Advanced Diagnostics. The advanced diagnostics capability was well suited for this flame instability detection that required high frequency process monitoring. The Rosemount 3051S measured the amplitude of the process noise by sampling at 22 times per second and provided a secondary variable (standard deviation) for early detection of flame instability. Additionally, this transmitter is very accurate and reliable even in the low pressure ranges, which is typical for draft pressures in fired heaters. A HART® Tri-Loop was used to provide the standard deviation variable to the legacy host system for continuous diagnostic monitoring of flame instability.

The advanced diagnostics capability of the Rosemount 3051S has provided this refinery with a viable means of reducing the risk of low NOx burner flame-out and preventing unplanned heater shutdowns. In addition, this also decreased the safety risk of creating an explosive environment in the fired heater.

RESOURCES

Rosemount 3051S with Advanced Diagnostics

[Emerson.com/3051S-Advanced-Diagnostics](https://emerson.com/3051S-Advanced-Diagnostics)

Emerson Terms and Conditions of Sale are available upon request.
The Emerson logo is a trademark and service mark of Emerson Electric Co.
Rosemount is a mark of one of the Emerson family of companies.
All other marks are the property of their respective owners.
© 2019 Emerson. All rights reserved.

 [Linkedin.com/company/Emerson-Automation-Solutions](https://www.linkedin.com/company/Emerson-Automation-Solutions)
 [Twitter.com/Rosemount_News](https://twitter.com/Rosemount_News)
 [Facebook.com/Rosemount](https://www.facebook.com/Rosemount)
 [Youtube.com/user/RosemountMeasurement](https://www.youtube.com/user/RosemountMeasurement)

Global Headquarters

Emerson Automation Solutions

6021 Innovation Blvd.

Shakopee, MN 55379, USA

 +1 800 999 9307 or +1 952 906 8888

 +1 952 949 7001

 RFQ.RMD-RCC@Emerson.com

Europe Region

Emerson Automation Solutions Europe GmbH

Neuhofstrasse 19a P.O. Box 1046

CH 6340 Baar, Switzerland

 +41 (0) 41 768 6111

 +41 (0) 41 768 6300

 RFQ.RMD-RCC@Emerson.com

Middle East and Africa Region

Emerson Automation Solutions

Emerson FZE P.O. Box 17033,

Jebel Ali Free Zone - South 2

Dubai, United Arab Emirates

 +971 4 8118100

 +971 4 8865465

 RFQ.RMTMEA@Emerson.com

Asia Pacific Region

Emerson Automation Solutions

1 Pandan Crescent

Singapore 128461

 +65 6777 8211

 +65 6777 0947

 Enquiries@AP.Emerson.com

00830-2300-4801, Rev BA